AAIB Bulletin No: 10/93 Ref: EW/G93/08/03 Category: 1.3

Aircraft Type and Registration: Auster J5 Aiglet Trainer, G-ANWX

No & Type of Engines: 1 De Havilland Gipsy Major 10 Mk. 2-1 piston engine

Year of Manufacture: 1955

Date & Time (UTC): 1 August 1993 at 1500 hrs

Location: Nayland Airfield, Suffolk

Type of Flight: Private

Persons on Board: Crew - 1 Passengers - 2

Injuries: Crew - None Passengers - None

Nature of Damage: Aircraft destroyed

Commander's Licence: Private Pilot's Licence

Commander's Age: 30 years

Commander's Flying Experience: 208 hours (of which 54 were on type)

Last 90 days - 19 hours Last 28 days - 8 hours

Information Source: Aircraft Accident Report Form submitted by the pilot and

telephone enquiries by the AAIB

Following a normal landing on the grass Runway 32 at Nayland the aircraft swung violently to the right; although the pilot applied full left rudder and brake the aircraft continued turning to the right. After turning through almost 180°, the left undercarriage leg tipped over the edge of a bank and the aircraft overturned.

Runway 32 at Nayland is approximately 500 metres long; the northerly half is level but the first 250 metres has a significant upslope. Because of this slope, landings are generally in a northerly direction. At the time of the accident the weather was good and the surface wind was 180°/07 kt gusting to 15 kt.

After the accident, the pilot reports that marks on the runway indicated that both left and right brakes were being applied as the aircraft left the runway. He subsequently spoke to his front seat passenger and surmised that the passenger caught his foot under the right rudder pedal as it moved back, thus unintentionally applying right brake; the pilot reported that this inadvertant application of brake made the aircraft uncontrollable.